Vintage Restoration Article

Legend for 57' Custom Safari 2 Door Seat, Cargo and Tailgate Interior Trim Pieces

Length in Inches

Holes

Code Letter

	Cour Letter	Length in Inches	" Holes	
P X	A	43 5/8	7	
	B C	CURVED	3	
	C	5 7/8	1	
	F	CURVED	3	
	P	46	8	
/\ \ \ \ \ \ \ \ \ \ \ \ \ \	S T	20 5/8	1	
	T	21	1	
	V	9 1/8	2	
$Q \rightarrow \cdot \cdot \cdot \cdot \cdot \cdot \cdot \cdot \cdot $	Z	34 7/8	5	
	AA	34	5	
R	DD	33 3/4	5	
	EE	42 1/4	7	
S AA	FF	15	3	
T BB	GG	20 3/8	5	
	II	20 3/8	5	
			2	
U	E	13	3	
V W EEDI	L	17 1/2	3	
** #	R	45 1/2	6	
	W	19 1/4	3	
	X	24 3/4	4	
FF - I O O O O O O	HH	15	3	
	Q	41 1/8	5	
	U	6 1/2	1	
cc // / /	Y	25 7/8	3	
GG /	BB	15 1/8	3	
HH—/	CC	6 5/8	1	

Vintage Restoration Article

Cargo Area Trim for Safaris ~ By Michael Munger


One area of Safaris which is usually in need of repair and restoration is the rear interior cargo seat. Some Ex-Safari owners seem to have thought that the cars were designed for transporting cattle! Often the stainless and other trim pieces are gone or badly damaged. I hope these diagrams and charts will be useful to the Safari lover in locating and replacing the parts for their cargo areas. The information presented here was derived from a '57 2 door Custom Safari. I imagine that the other years are different in some aspects and care should be taken transferring this information to other years and models.

Legend for '57 Custom Safari 2 Door Seat, Cargo and Tailgate Interior Trim Pieces.

- Seat Edge Trim (3/4x1/2)
- Cargo Edge Trim (5/8x1/2)
- Tailgate Edge Trim (1/2x1/8)

Special Pieces:

Code Letter:	Description:	
D	Hinge Cover	
1	Corner Cover	
la	Special Corner Piece	
lb	Special Corner Piece	

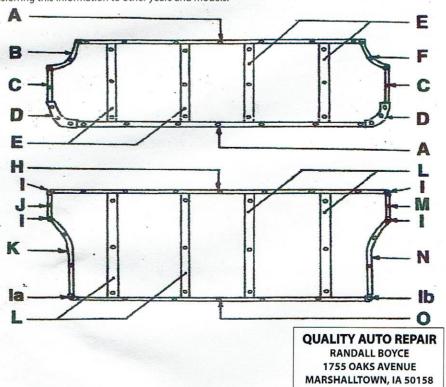

www.qualityauto56.com